


---

# BUILDING PERFORMANCE: HURRICANE INIKI IN HAWAII

OBSERVATIONS, RECOMMENDATIONS,  
AND TECHNICAL GUIDANCE

*Learning from failure...*

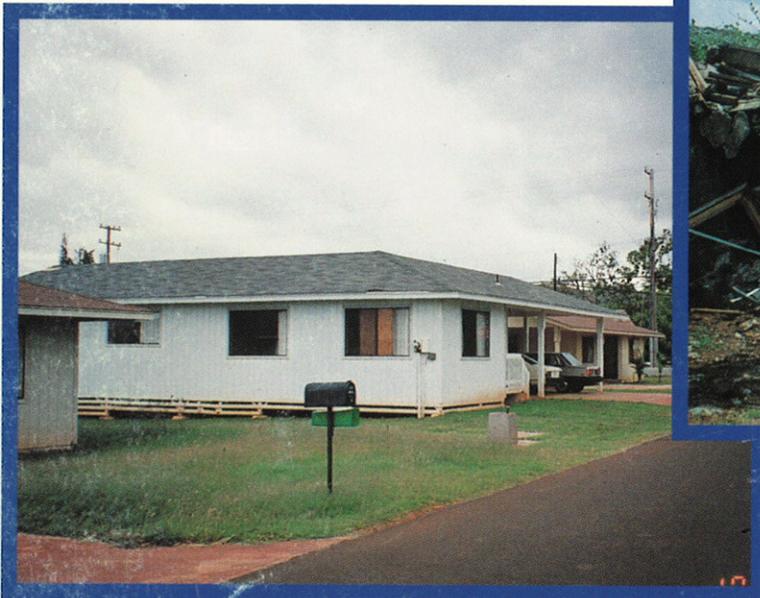

*...building on success*

*Teaming To Reduce Future Damages*



FEDERAL EMERGENCY MANAGEMENT AGENCY  
FEDERAL INSURANCE ADMINISTRATION

IN COOPERATION WITH  
THE STATE OF HAWAII OFFICE OF CIVIL DEFENSE  
AND KAUAI COUNTY

---

# BUILDING PERFORMANCE: HURRICANE INIKI IN HAWAII


OBSERVATIONS, RECOMMENDATIONS,  
AND TECHNICAL GUIDANCE



FEDERAL EMERGENCY MANAGEMENT AGENCY  
FEDERAL INSURANCE ADMINISTRATION

JANUARY 29, 1993

---



# TABLE OF CONTENTS

EXECUTIVE SUMMARY .....	1
1.0 INTRODUCTION .....	5
1.1 Purpose .....	5
1.2 Background .....	5
1.3 The Building Performance Assessment Team.....	6
1.3.1 Team Composition .....	7
1.3.2 Purpose of the Team .....	7
1.3.3 Team Activities .....	8
1.3.4 The “Team” Concept .....	8
1.4 Hurricane Iniki — Storm Conditions .....	9
1.5 National Flood Insurance Program Requirements .....	11
1.6 Building Code Requirements for Wind Hazards.....	12
2.0 OBSERVATIONS OF FLOOD DAMAGE AND COASTAL FLOODPLAIN CONSTRUCTION .....	15
2.1 Kekaha .....	15
2.2 Poipu Beach .....	17
2.3 Conclusions.....	28
3.0 OBSERVATIONS OF WIND DAMAGE AND SUCCESSFUL BUILDING PERFORMANCE UNDER WIND LOADING CONDITIONS .....	31
3.1 Field Sites.....	31
3.2 Observations of Building Performance under Wind Loading .....	32
3.3 Diagnostic Modes of Structural Failure .....	33
3.4 Diagnostic Modes of Successful Structural Performance .....	44

3.5	Roof Sheathing .....	47
3.6	Roof Cladding .....	52
3.7	Glazing and Transparent Openings .....	54
3.8	Windborne Debris .....	60
3.9	Deterioration .....	62
3.10	Pre-Engineered Steel Warehouses.....	62
4.0	RECOMMENDATIONS .....	67
4.1	Floodplain Management and Flood Damage .....	67
4.2	Wind Damage and Wood-Frame Construction .....	80
4.3	Glazing and Transparent Structural Openings .....	92
4.4	Roofing.....	95
4.5	Building Permitting, Plan Review, and Inspection.....	95
4.6	Training and Education .....	97
4.7	Repair/Retrofit of Partially Damaged and Undamaged Buildings .....	98

## LIST OF TABLES

Table 1	Residential Buildings Substantially Damaged by Flooding at Poipu Beach.....	18
---------	--------------------------------------------------------------------------------	----

## LIST OF FIGURES

- Figure 1 The eye of Hurricane Iniki crossed the Kauai coast just west Port Allen near Kaumakani just before 4:00 p.m. Hawaiian Standard Time on September 11,1992. ....6
- Figure 2 Hurricane Iniki produced substantial wind speeds at low altitudes in excess of the 80-mph base condition. ....11
- Figure 3 Portion of Flood Insurance Rate Map (FIRM) for Kauai County covering the Poipu Beach area. ....13
- Figure 4 Various flood hazard zones, including velocity (V) Coastal High Hazard zones, on the Kauai County FIRM (Hanalei example). ....13
- Figure 5 Flood damage to this coastal house in Kekaha was minimized because the house is elevated 2 to 3 feet off the ground and is located a considerable distance from the shoreline. ....16
- Figure 6 Results of preliminary field inventory of damaged residential buildings — Poipu Beach Park to Spouting Horn Park. ....18
- Figure 7 Waterborne debris resulted in significant damage to non-elevated buildings along Poipu Beach. ....19

Figure 8	Typical example of residential construction along Poipu Beach that was destroyed because it was not elevated above the flood hazard. ....	20
Figure 9	Non-elevated house at Poipu Beach that floated off its foundation and was transported well inland. ....	20
Figure 10	Non-elevated house at Poipu Beach that floated off its foundation was pinned against another house and destroyed by waves. ....	21
Figure 11	Non-elevated building at Poipu Beach that rammed and increased damage to an adjacent building. ....	22
Figure 12	Non-elevated building at Poipu Beach destroyed by coastal flooding. ....	22
Figure 13	Non-elevated building at Poipu Beach destroyed by coastal flooding. ....	23
Figure 14	Interior of non-elevated building at Poipu Beach destroyed by coastal flooding. ....	23
Figure 15	Foundation at Poipu Beach undermined by erosion. ....	25
Figure 16	Undermining of shallow pier foundation at Poipu Beach due to lack of sufficient embedment below erosion depth. ....	25
Figure 17	Breakup of grouted lava rock walls at Poipu Beach generated waterborne projectiles. ....	26

Figure 18	Waterborne lava rock projectiles at Poipu Beach increased damage to non-elevated buildings. ....	26
Figure 19	Non-elevated buildings at Poipu Beach. ....	29
Figure 20	Typical non-elevated condominium or hotel. ....	29
Figure 21	Once the roof system is compromised, the ability of the wood-frame exterior walls to withstand external wind pressure is greatly diminished. ....	34
Figure 22	Roof rafter construction with simple nailing or toenailing failed under uplift forces. ....	35
Figure 23	Toenailing of ridge beam to gable-end support. ....	35
Figure 24	Toenailing of rafter to ridge beam. ....	36
Figure 25	Toenailing of roof rafters to wall system. ....	36
Figure 26	Example of improperly sized and placed metal fastener, which led to roof failure from wind uplift forces. ....	37
Figure 27	Undersized and improperly attached metal fasteners led to roof damage from uplift forces. ....	39
Figure 28	Individual prefabricated wood roof trusses performed relatively well. ....	39
Figure 29	Gable-end roof failure due to loss of roof sheathing and lack of gable bracing. ....	40

Figure 30	Improper connection (toenailing) between roof trusses and wall systems. ....	41
Figure 31	Gable-end roof designs tended to be more failure-prone. ....	41
Figure 32	Low-pitched hip roofs are aerodynamically superior and generally performed better than steeply pitched gable-end roofs. ....	42
Figure 33	Offset roof peak provides geometric discontinuity and results in greater localized wind-induced pressure, which can lead to roof and then wall failure. ....	42
Figure 34	Excessive roof overhang and poor connections in many instances led to roof failure. ....	43
Figure 35	Example of very successful heavy-gauge metal fastener connecting roof and wall systems. ....	45
Figure 36	Wood splice or strap provides a secure connection between wall and roof systems. ....	45
Figure 37	Sensitive craftsmanship and attention to detail. ....	46
Figure 38	Improper attachment of sheathing to purlins. ....	47
Figure 39	Improper nailing design and schedule for purlin-to-rafter attachment. ....	48

Figure 40	Loss of roof sheathing due to improper nailing design and schedule. ....	48
Figure 41	Total roof failure due to loss of sheathing. ....	50
Figure 42	Failure of corrugated metal roof at attachment points. ....	50
Figure 43	Metal roof loss generates large airborne projectiles, which often cause additional damage. ....	51
Figure 44	Loss of roof cladding due to failure at attachment points. ....	53
Figure 45	Heavy concrete tile attached at one point with undersized nail. ....	53
Figure 46	Roof cladding systems composed of interdependent elements. ....	55
Figure 47	Glazing broken by windborne debris or direct wind pressure. ....	55
Figure 48	Loss of opening protection allows wind entry and increases internal exposure. ....	56
Figure 49	Implosion of transparent shatter-resistant sliding door. ....	56
Figure 50	Improper attachment of window unit. ....	57
Figure 51	Improper connection of sliding glass door. ....	58

Figure 52	Gable-end window unit as a whole was displaced inward by wind pressure. ....	58
Figure 53	Extensive use of glazing on windward side can significantly compromise a building's envelope and lead to roof failure. ....	59
Figure 54	In-place protective devices for glazing reduced the occurrence of building envelope failures. ....	60
Figure 55	Windborne debris impact can puncture building and allow buildup of internal wind pressure. ....	61
Figure 56	Steel warehouse failure commonly was due to loss of light-gauge metal sheet cladding. ....	63
Figure 57	Steel warehouse failure was also due to failure of structural steel members. ....	63
Figure 58	Failure of steel warehouse due to age and weatherization and insufficient anchorage to resist uplift. ....	64
Figure 59	Steel warehouse, sill-to-concrete-foundation failure at anchoring points. ....	64
Figure 60.	NFIP requirements for elevated foundations in V zones. ....	68
Figure 61.	One method of support for piers is a reinforced concrete footing. ....	69
Figure 62.	Drilled pier foundation. ....	70

Figure 63. Reinforced concrete pier. ....	70
Figure 64. Reinforced concrete masonry pier. ....	71
Figure 65. Reinforced brick pier. ....	71
Figure 66. Posts are placed into pre-dug holes and may be anchored in a concrete pad at the bottom of the hole. ....	72
Figure 67. Posts can also be anchored in concrete encasements. ....	73
Figure 68. Post on concrete bearing pad. ....	74
Figure 69. Post on concrete bearing pad. ....	74
Figure 70. Post in concrete backfill. ....	75
Figure 71. Post on earth bearing. ....	75
Figure 72. Spike anchorage of post. ....	76
Figure 73. Galvanized strap anchorage of post. ....	76
Figure 74. Pilings are mechanically driven into the ground, making them less susceptible to velocity flooding, scour, and pullout. ....	77
Figure 75. The depth of pile embedment provides stability to resist lateral and vertical loads through passive earth pressures. ....	78
Figure 76. Post/pile foundation. ....	78

Figure 77. Recommended wood-frame construction. ....	81
Figure 78. Typical roof truss top chord bracing. ....	82
Figure 79. Detail A– Typical web bracing. ....	82
Figure 80. Detail B– Typical wood gable-wall bracing with nailed connections. ....	83
Figure 81. Typical hurricane strap to roof framing detail.....	84
Figure 82. Recommended hip roof framing. ....	85
Figure 83. Hip roof framing connectors.....	86
Figure 84. General notes for Figures 85-87.....	88
Figure 85. Existing “single wall” on slab-on-grade.....	89
Figure 86. Existing “single wall” on existing concrete masonry unit wall.....	90
Figure 87. Existing “single wall” on new concrete masonry unit wall and footing. ....	91
Figure 88. Prefabricated storm shutters. ....	92
Figure 89. Previously purchased plywood stored for use as openings protection during storm conditions.....	93
Figure 90. Plywood used as openings protection installed. ....	93


Figure 91. Typical installation of plywood openings protection for  
wood-frame building. ....94

Figure 92. Tips for galvanized roofing. ....96

## APPENDIX

### APPENDIX A

Building Performance Assessment Team Members and Advisors .....99



# EXECUTIVE SUMMARY

On September 22, 1992, at the request of the Mayor of Kauai County, the Federal Coordinating Officer for the Iniki disaster tasked the Federal Emergency Management Agency's (FEMA's) Federal Insurance Administration (FIA) to assemble a team of experts to assess the performance of buildings. Since the 1970s, FIA has gained valuable experience through an ongoing assessment program that focuses on the performance of buildings that have incurred flood damage. In addition, FIA's National Flood Insurance Program establishes regulations for the reconstruction of substantially damaged buildings in floodplains, regardless of the cause of the damage.

For the Iniki disaster, the team assembled by FIA included FEMA Headquarters and Regional staff, representatives of the State of Hawaii Office of Civil Defense and Kauai County, and Registered Professional Engineers and Architects from both Kauai and Oahu (see Appendix A for complete list). The team was tasked with surveying the performance of primarily residential structures under wind and water forces generated during Hurricane Iniki. The goal of this effort is to provide guidance and offer recommendations for reducing damage from future hurricanes. This goal is best met through learning from both failures and successes of building performance.

During the field assessment, the team investigated primary structural systems, i.e., systems in a building that resist lateral and vertical forces. For all buildings, the performance of exterior architectural systems, such as roofing, windows, and doors was analyzed. The analysis also included the effects of windborne and waterborne debris and the quality of construction and materials. The majority of building types observed were one- and two-story, wood-frame, single-family and multi-family residential structures. However, pre-engineered steel commercial and industrial buildings, as well as resort hotels and condominiums constructed of reinforced concrete and masonry, were also examined.

## WIND FORCES

Noteworthy examples of adequately engineered and constructed buildings were observed in Kauai County. Almost without exception, successful performance resulted from clearly defined and continuous “load transfer paths” from the roof to the foundation. A well-designed load transfer path depends primarily on the proper type, sizing, and attachment of connections between the critical components of a building (for example, between the roof and walls and between the walls and foundation). Where connections, such as hurricane clips and metal straps on wood-frame structures, were adequately sized and correctly applied, buildings performed relatively well.

Incomplete design and construction for load transfer and improper connections, especially between the roof and walls, were found to be the most important factors causing structural failure of buildings due to uplift wind forces. Consistently, a building’s structural integrity was compromised through the action of uplift forces on insufficiently designed and connected roof and wall systems. Loss of roof cladding (e.g. shingles), roof sheathing (e.g., plywood), and other building attachments provided a source of airborne projectiles which contributed to the overall damage. In many instances, loss of glazing (e.g., glass doors and windows), either from direct wind pressure or from debris impact, resulted in a breach of the building envelope, subsequent internal pressures, and progressive structural failure.

Much of the damage to structures caused by wind forces resulted from incomplete design, reliance on outdated methods of workmanship, and/or misapplication of various building materials. Many of these problems can be addressed by training and education programs that promote prudent building design and construction practices throughout Kauai County. This is especially true for buildings in bluff and oceanfront areas exposed to accelerated wind forces.

## FLOOD FORCES

In coastal floodplains and Coastal High Hazard Areas, the obvious primary cause of building failure was direct wave impact (hydrodynamic forces) on buildings whose lowest floors had been constructed directly on the ground surface. Low-lying, oceanfront buildings, situated somewhat landward of the shoreline and having lowest floors elevated above the flood hazard, fared much better than ground-level buildings immediately adjacent to the shoreline. Waterborne debris such as lava boulders and debris from damaged non-elevated buildings increased damage to adjacent buildings.

## RECOMMENDATIONS

Recommendations presented in this report can be summarized as follows :

- Provide adequate means and methods to ensure the structural integrity of a building by constructing properly engineered buildings which consider the continuous load transfer path of a structure from roof to foundation. To ensure the integrity of the structure's load transfer path, metal fasteners ("hurricane clips") and straps must be adequately sized and properly installed.
- Design all architectural elements to resist the same wind forces as the primary structural systems.
- Construct and properly engineer buildings such that they protect, or contain adequately designed, glasswork in exposed areas; adhere to nailing and attachment requirements for roof sheathing, roof cladding, and windows and doors; and provide routine maintenance of building components, including repair and replacement of damaged elements.
- In areas subject to flooding, elevate buildings above predicted flood heights on properly designed and constructed foundations. Minimize the

sources of future debris by appropriately designing and locating site improvements such as stone walls.

- Provide a program of training and continuous education to code enforcement officials, plan reviewers, inspectors, supervisors, and others who are charged with implementing the recommendations noted above. Provide companion training and education programs for homeowners, building contractors, and design professionals in the proper construction techniques for mitigation of wind and flood hazards.
- Trade associations, labor associations, etc., should provide continuing education programs for updating their members concerning revisions to Building Codes under which they are performing their trades.

This report includes detailed engineering discussions of building failure modes and successful building performance. It also provides detailed recommendations for enhancing building performance under hurricane and flood conditions.